


Deck Restoration Procedure

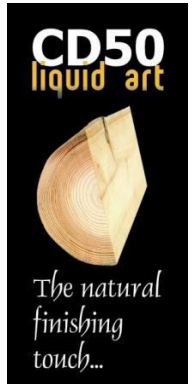

Before you start:

Make sure deck has not been previously treated with stain, paint or oil. If it has, any previous treatment must be completely removed.

Decide:

If you want to maintain the colour of the cleaned deck, or if you want it to silver naturally. For the silvered effect - use CD50 Liquid Art Clear (i.e. no Colourtone)
To maintain the colour - add a Colourtone to the CD50 Liquid Art
(Popular colours are Kwila & Walnut Colourtones for Kwila decks - Hickory for Pine decks)
Testpots are available - apply to inconspicuous part of deck - wait until next day to decide

Measure:

Calculate the deck area in square meters
Calculate how much product you will need
1 litre of WAY2GO cleans about 8 square meters (dilute up to 50/50 with water - use undiluted if deck is badly stained)
1 litre of CD50 Liquid Art covers approx 6-8 square meters

Purchase:

WAY2GO & CD50 Liquid Art (with or without Colourtone - as above)
(CD50 and the support products can be purchased at most Hardware & Paint shops - phone us on 0800 107 555 to find your nearest supplier)

Clean:

1. Wet the deck
3. Spray or brush WAY2GO over deck
4. Leave overnight
5. Gently waterblast off with a fan spray (no more than 80 bar or 800 psi) holding the nozzle an even distance from the timber - feather up at finish of strokes to prevent "stop" marks. Continue until all foaming has stopped. This may take a lot of washing.
6. Leave to dry completely
7. Apply CD50 Liquid Art to deck - with brush, speedbrush or roller - use sparingly
8. CD50 takes longer to penetrate into hardwood timber and penetrates slower in cooler weather - allow for this
9. After 6 weeks apply a second coat of CD50 – again sparingly
10. Rewash and reapply as necessary every 1 - 3 years to keep the desired appearance